

February 15, 2018

Dr. Bob Harrington Inyo County Water Department 135 South Jackson Street Independence, CA 93526

RE: Summary of Hydrologic Monitoring Activities, January 2018 Rose Valley, Inyo County, California Hay Ranch Project Conditional Use Permit #2007-03

Dear Dr. Harrington:

This letter summarizes hydrologic monitoring activities conducted in January 2018 by TEAM Engineering & Management, Inc. (TEAM), related to the Hay Ranch Water Extraction Project and CUP #2007-03.

Background

As outlined in the Hay Ranch Water Extraction Final EIR's Hydrologic Monitoring and Mitigation Plan (HMMP), Phase 1: Monitoring System Setup and Supplemental Data Collection occurred prior to December 25, 2009 at monitoring points throughout Rose Valley. With the initiation of pumping by Coso Operating Company, LLC (COC) on December 25, 2009, the Hay Ranch Water Extraction Project entered into the Phase 2: Startup Monitoring and Reporting period. Phase 3: Model Recalibration and Redefinition of Pumping Rates and Durations occurred from September 2010 to April 2011, with recalibration of the groundwater model by Daniel B. Stephens & Associates (DBS&A) and with redefinition of pumping rates and durations by Inyo County Water Department (ICWD). With the April 1, 2011 issuance of the ICWD's "Addendum to the HMMP for CUP#2007-003/Coso Operating Company, LLC" (2011 ICWD Addendum) the project entered Phase 4: Ongoing Monitoring, Mitigation and Reporting. In 2013 further model revision occurred with results and new trigger levels detailed in ICWD's August 30, 2013 letter to COC regarding Conditional Use Permit #2007-003/Coso. In June 2014 further model revision was conducted by DBS&A with results and new trigger levels detailed in ICWD's June 27, 2014 letter to COC regarding Conditional Use Permit #2007-003/Coso. On June 20, 2016 the ICWD extended the June 30, 2016 cessation of pumping date to September 30, 2016 which allowed COC to pump up to the remaining volume from the 1,614 AF allowed for the previous year, as long as all other conditions of the CUP #2007-03 were adhered to.

In mid-2017 re-evaluation of pumping rates and duration based on recalibration of the model was conducted by DBS&A. Continuation of pumping, at a rate not to exceed 1,611 acre-feet annually beginning on June 1, 2017, was approved in ICWD's July 27, 2017 letter to COC regarding Conditional Use Permit #2007-003/Coso. Revised Maximum Acceptable Drawdown and Drawdown at Cessation of Pumping values were provided in the DBS&A report titled "Third Updated Groundwater Flow Model and Predictive Simulation Results, Coso Operating Company, Hay Ranch Water Extraction and Delivery System" dated August 24, 2017.

Monitoring and Reporting

During the January 2018 monthly hydrologic data collection event at the monitoring locations in the Rose Valley area, static depth-to-water (DTW) measurements, one visual observation of the Little Lake Ranch (LLR) Siphon Well Outflow and three sets of flow rates were collected by TEAM, as summarized in the

attached table (Table 1). Data for this monthly field event was collected on January 29 and 30, 2018. Pressure transducer data was downloaded from monitoring units including one "BaroTroll" which records barometric pressure. Also in January, measurements from LADWP 816 Well were provided by LADWP personnel.

Figure 1 presents the combined amount of groundwater pumped from the Hay Ranch North and South wells, in acre-feet, from December 25, 2009 through January 29, 2018 compared to the maximum allowable pumping amounts. The total amount of groundwater extracted from the Hay Ranch property from December 25, 2009 to January 29, 2018 (Hay Ranch CUP project total) is approximately 17,225 AF. The maximum allowable pumping rate was 3,000 acre-feet per year (AFY) for December 25, 2009 through December 31, 2010; was 4,839 AFY from January 1, 2011 through August 30, 2013; was 3,040 AFY from September 2013 through June 2014; was 1,614 AFY from July 1, 2014 to June 30, 2016, extended by ICWD to September 30, 2016; and is 1,611 AFY from June 1, 2017 to May 31, 2019.

Trigger Levels and Maximum Acceptable Drawdowns

In Table 4 of the August 24, 2017 DBS&A report, Drawdown at Cessation of Pumping Trigger Levels (Trigger Levels) and Maximum Acceptable Drawdowns were recommended for specific monitoring wells, based on a maximum allowable pumping rate of 1,611 AFY starting on June 1, 2017.

Based on data collected by TEAM during the December 2017 to January 2018 monitoring period, none of the Trigger Levels were exceeded at Hay Ranch Project monitoring wells which have baselines and trigger levels established (Table 2). No Maximum Acceptable Drawdown levels have been reached during COC pumping under CUP #2007-03.

Operational Notes

In January, a water level measurement was unable to be collected from the Red Hill Well (RV-120) as this well was inaccessible. There were no other significant operational issues observed during the reporting period.

Data Transmittal

TEAM posted updates to the "Coso" database on the ICWD web server. Current Hay Ranch Project hydrographs in PDF form were uploaded to the ICWD website (<u>www.inyowater.org</u>).

If you have any questions or require additional information, please contact TEAM at your convenience.

Sincerely,

TEAM Engineering & Management, Inc.

Any M Fost

Greg M. Foote Senior Environmental Scientist

S:\Coso.HRMonitoring Summary_January_2018

TABLE 1 Field Observations of Rose Valley Hydrologic Monitoring Points January 2018

Project Name:	Hay Ranch Project HMMP			Date: January 29-30, 2018					
Location:	Rose Valley, Inyo County								
Observer(s):	G. Foote			Page: 1 of 1					
							-		
Well ID	Monitoring Point	Date	Time	DTW	Flow	GWE	Method	Transducer	Notes
				(ft)	(cfs)	(ft amsl)		Log Interval	
RV-10	Dews	NM	NM	NM	NA	NM	TEAM manual read	NA	
RV-20	LADWP 816	01/03/18	14:21	78.05	NA	3437.01	LADWP manual read	NA	Data provided by LADWP
RV-30	Cal Pumice	01/29/18	9:48	234.77	NA	3271.12	TEAM manual read	Hourly	
RV-40	Dunmovin	NM	NM	NM	NA	NM	TEAM manual read	NA	Discontinued due to new in-well infrastructure
RV-50	Hay Ranch North	01/29/18	13:14	NM	NA	NM	TEAM manual read	NA	3,574,868,990 gallons (10,971 AF) pumped since 12/25/09
RV-60	Hay Ranch 1A	01/29/18	13:28	195.41	NA	3236.76	TEAM manual read	Hourly	
RV-61	Hay Ranch 1B	01/29/18	13:24	209.71	NA	3222.14	TEAM manual read	Hourly	
RV-62	Hay Ranch 1C	01/29/18	13:21	205.55	NA	3225.95	TEAM manual read	NA	
RV-70	Hay Ranch South	01/29/18	13:15	NM	No	NM	TEAM manual read	NA	2,037,805,531 gallons (6,254 AF) pumped since 12/25/09
RV-80	Hay Ranch 2A	01/29/18	13:47	200.16	NA	3232.84	TEAM manual read	Hourly	
RV-81	Hay Ranch 2B	01/29/18	13:43	211.05	NA	3221.58	TEAM manual read	Hourly	
RV-82	Hay Ranch 2C	01/29/18	13:41	203.67	NA	3228.43	TEAM manual read	NA	
RV-90	Coso Jct Ranch	01/29/18	10:27	175.53	NA	3227.60	TEAM manual read	NA	
RV-100	Coso Jct Store #1	01/29/18	10:01	146.70	NA	3225.42	TEAM manual read	Hourly	
RV-110	Davis Ranch North Well	01/29/18	10:39	6.58	NA	3886.48	TEAM manual read	Hourly	
RV-111	Davis Ranch South Well	01/29/18	10:57	13.35	NA	3884.71	TEAM manual read	Hourly	Pump installed in DR South well
RV-112	Davis Ranch South Flow	NM	NM	NM	NM	NM	TEAM manual read	NA	Discontinued: Flow actively managed
RV-120	Red Hill Well (BLM)	12/13/17	10:18	141.04	NA	3199.79	TEAM manual read	Hourly	Well inaccessible in January 2018
RV-130	G-36	01/29/19	12:57	182.86	NA	3197.16	TEAM manual read	NA	
RV-140	Lego	01/29/18	12:45	224.81	NA	3198.04	TEAM manual read	Hourly	
RV-150	Cinder Road	01/29/18	11:24	192.13	NA	3185.83	TEAM manual read	Hourly	Blockage in well, DTW not possible
RV-160	18-28 GTH	01/29/18	12:33	174.99	NA	3187.59	TEAM manual read	NA	
RV-170	Fossil Falls Campground	01/29/18	11:33	142.02	NA	3174.75	TEAM manual read	NA	
RV-180	LLR North Well	01/30/18	10:56	40.77	NA	3158.33	TEAM manual read	Hourly	
RV-210	LLR Dock Well	01/30/18	11:10	6.35	NA	3147.79	TEAM manual read	NA	Surveyed measuring point removed, DTW measured to TOC
RV-220	LLR Stilling Well (lake surface)	01/30/18	11:14	3.92	NA	3147.12	TEAM manual read	Hourly	
RV-230	LLR Little Lake Outflow	01/30/18	11:30	NA	1.11	NA	TEAM manual read	Hourly	
RV-240	LLR Coso Springs Flow	01/30/18	11:50	NA	0.41	NA	TEAM manual read	Hourly	
RV-245	LLR North Culvert Flow	01/30/18	12:12	NA	1.70	NA	TEAM manual read	Hourly	
RV-250	LLR Siphon Discharge	01/30/18	12:09	NA	Yes	NA	TEAM visual read	NA	Siphon Well flowing into Pond 2
RV-260	LLR Hotel Well	01/30/18	10:40	-0.01	NA	3138.79	TEAM manual read	NA	Artesian

NM - not measured; NA - not applicable; IO - Inoperative; UA - Data currently unavailable

DTW - Depth to water in feet (ft) below top of casing or other reference point; a negative DTW indicates that the groundwater elevation is above the surveyed reference point

Flow - In cubic feet per second (cfs)

GWE- Groundwater elevation in feet above mean sea level (ft amsl)

TABLE 2Hay Ranch Project Groundwater Baselines and Trigger LevelsJanuary 2018

Well ID	Monitoring Point	Point Baseline GWE ¹ Recent Date		Recent GWE	Recent GWE	Drawdown	Recent GWE	Recent GWE
			of Measurement		Compared to Baseline	Trigger Level ²	Compared to Trigger Level	Above Max DD ²
		(feet amsl)		(feet amsl)	(feet)	(feet)	(feet)	(feet)
RV-80	HR 2A	3240.92	01/29/18	3232.84	-8.08	16.9	8.82	9.52
RV-90	Coso Jct Ranch	3230.65	01/29/18	3227.60	-3.05	9.60	6.55	6.65
RV-100	Coso Jct Store #1	3227.59	01/29/18	3225.42	-2.17	8.60	6.43	6.53
RV-120	Red Hill Well	3200.66	12/13/17(3)	3199.79	-0.87	3.40	2.53	3.13
RV-130	G-36	3198.35	01/29/18	3197.16	-1.19	2.70	1.51	2.41
RV-140	Lego	3199.21	01/29/18	3198.04	-1.17	1.30	0.13	1.53
RV-150	Cinder Road	3186.92	01/29/18 (4)	3185.83	-1.09	1.50	0.41	1.31
RV-160	18-28 GTH	3187.67	01/29/18	3187.59	-0.08	1.20	1.12	2.22
RV-180	LLR North Well	3158.88	01/30/18	3158.33	-0.55	0.70	0.15	0.85

1) GWE: Groundwater elevation measured in feet above mean sea level. Baseline GWEs set January 2010 and March 2011 and approved by Inyo County Water Department (ICWD)

2) Max DD and Trigger Level: Maximum Acceptable Drawdown and Drawdown Trigger Level from Table 4 of the "Third Updated Groundwater Flow Model and Predictive Simulation Results, Coso Operating Company Hay Ranch Water Extraction and Delivery System, Conditional Use Permit (CUP) 2007-003" Dated August 24, 2017.

3) Well inaccessible in January 2018 due to flooding on access road.

4) Cinder Road well damaged in October 2017, surveyed measuring point removed. Accuracy of GWE calculation may be reduced.

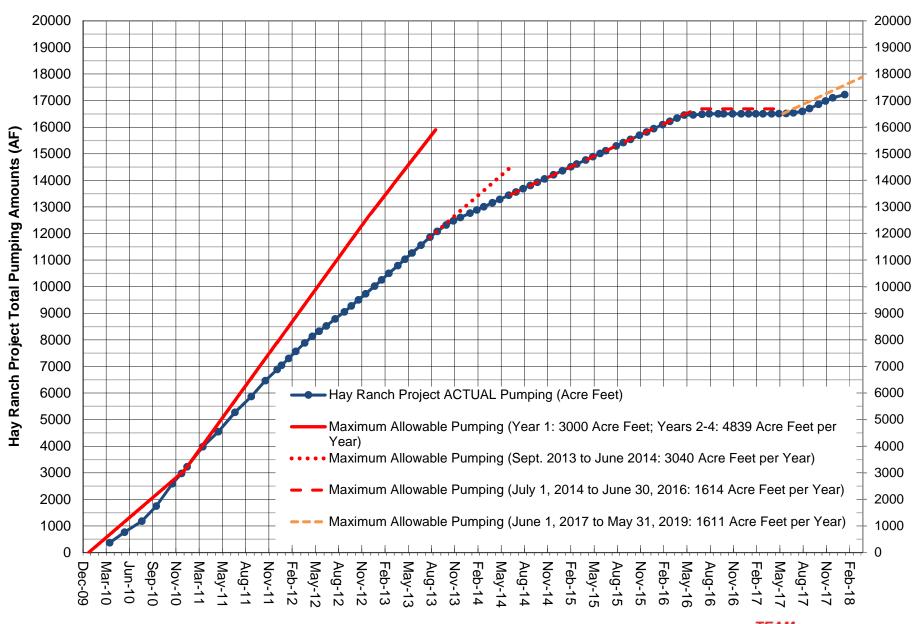


FIGURE 1 ACTUAL AND MAXIMUM ALLOWABLE PUMPING AMOUNTS (TOTALS) FOR HAY RANCH PROJECT

Note: The "maximum allowable pumping" is based on a pumping rate of 3000 AF/yr for 12/09 to 12/10, 4839 AF/yr for 1/11 to 8/13, 3040 AF/yr from 9/13 to 6/14, 1,614 AF/yr from 7/14 to 6/16 and 1611 AFY for 6/17 to 5/19.

TEAM ENGINEERING & MANAGEMENT, INC. Bishop and Mammoth Lakes, California